

18-415 Appendix 4

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
94499	Kahukura Park Tikitiki	Street skate	Small street skate	Erosion on side of skate	3	Fill erosion possibly planting would assist in holding the soil in place.	\$ -
	Kahukura Park Tikitiki	Safety surface	Surface for all items	Depth 250-300mm scuffed under swings	3	Install scuff mats.	\$400.00
94808	Matawai Township	Module	Module small	Equipment dirty	3	Clean	\$-
	Matawai Township by squash club	Module	Module small	Posts badly rotten all way through.	1	Remove this item	-
94917	Ormond Domain	Swings	3 bay 2 senior 1 junior	Top bolts rusting	3	Monitor	\$-
94919	Ormond Domain	Safety Surface	Surface for swings	Depth 300mm			\$-
94916	Ormond Domain	Maypole		Can't view top fittings too high, seats too low causing scuff.	3	Raise seat level to approx. 50cm. With a ladder inspect the top fittings for rust or wear.	\$-
94918	Ormond Domain	Safety Surface	Surface for maypole	Depth 300mm			-
94990	Patutahi Reserve	Swings	3 bay 2 senior 1 junior	Senior swing seats plates starting to lift - frame rusting.	2	Monitor replace swing seats	\$150.00
94991	Patutahi Reserve	Safety Surface	Surface for swings	Depth 300mm badly scuffed under swings.	3	Aerate and rake back scuff under swings regularly.	\$-
94997	Patutahi Reserve	Skate ramp	Timber ramp	Water ponding in centre looks like bracing on underside rotting.	3	fyi	-
94996	Patutahi Reserve	Basketball half court	Half court and hoop	Back-board rusting plate.	2	Monitor - programme replacement as required.	\$-
95037	Puawaitangi Park Ruatoria Playground	Module	Module large	Post rotting on wall climber. Track ride missing, worn shackles on chain walk, worn chain link on chain walk, posts rotting - 4 posts by slide, 2 by wall climber. Replace 2 ladders and wall climber rotting, tread uneven.	1	Replace chain links and shackle on chain bridge, replace 4 rotting posts, 2 ladders 1 wall climber all rotting, replace track ride.	\$2,500.00
95038	Puawaitangi Park Ruatoria Playground	Swings	Swings 3 bay 3 senior	Footing rusting, top clevis bolts rusting.	3	Monitor replace swing hanger bracket as required.	\$510.00
95038	Puawaitangi Park Ruatoria Playground	Swings	Swings 3 bay junior	Top clevis bolts rusting.	3	Monitor replace clevis bolts as required.	\$510.00
95038	Puawaitangi Park Ruatoria Playground	Swings	Swings 3 bay 3 senior	Top bolts rusting	3	Monitor replace clevis bolts as required.	\$510.00

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
95040	Puawaitangi Park Ruatoria Playground	Safety surface	Surface for swings	Bark badly scuffed under swings, bark low compact 200mm, timber edge broken in places.	2	Top up surface - repair timber edge.	\$1,500.00
95039	Puawaitangi Park Ruatoria Playground	Safety surface	Surface for module	Depth low at 50-150mm compact worn, nil under slide concrete footing exposed on wall climber.	3	Top up surface and aerate.	\$1,768.00
95043	Puawaitangi Park Ruatoria Playground	Skate street skate	Street skate	Edges breaking away in one part, concrete dirty and build-up of silt and rubbish, water ponding in places.	3	Fill soil on edge, remove graffiti.	\$200.00
95041	Puawaitangi Park Ruatoria Playground	Basketball half court	Half court and hoop	Back-board rusting.	3	Monitor replace as required.	\$-
95369	Te Araroa Community Playground	Swings	3 bay swings - 2 senior 1 junior	Clevis bolts rusted, one rusted badly, frame rusting.	2	Replace 6 clevis bolts.	\$170.00
95370	Te Araroa Community Playground	Safety surface	Surface for swings	Mats uneven in places.	3	Secure mats down and fill up splits.	\$50.00
95368	Te Araroa Community Playground	Module	wooden	Sharp edges of removed D loops remain x4, both slide footings rusted through x 3 badly rusted will break, slide missing panels off, climber and ladder rusting.	1	Repair fill holes of old D loop - replace 4 slide supports, replace slide	\$1,500.00
95371	Te Araroa Community Playground	Safety surface	Surface for module	Mats split and lifted and uneven.	2	Repair surface - re-secure tiles.	\$200.00
95351	Te Araroa skate	Skate bowl	Street skate	Eroding in places, coping to concrete edge cracking.	3	Fill cracks, plant erosion to retain edges.	\$100.00
95372	Te Araroa skate	Basketball half court	Half court and hoop	Concrete broken at base of hoop, hoop badly rusted plate on back-board - be aware of structural integrity.	2	Replace broken concrete pad, replace back-board and hoop capital renewal cost.	\$-
95393	Te Karaka Recreation Ground	Module medium	Jungle gym with slides 45m ²	Posts rotting, deck splintered, chain links worn, equipment dirty mossy, nails exposed on decks x3 not fixed since 2017 was Priority One then.	1	Replace 7 rotten posts, one rotten through, replace chain link, remove nails, plane off deck.	\$700.00
95395	Te Karaka Recreation Ground	Safety surface	Surface for all items				
102706	Te Karaka Recreation Ground	Swings	3 bay swings 2 senior 1 junior	Plate junior swing starting to lift.	3	Tamper down.	\$-

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
108615	Te Karaka Recreation Ground	Module	Module small	Toggle on slides			\$-
95394	Te Karaka Recreation Ground	Space net	Net	Tension of ropes loose.	2	Re-tension the net.	\$-
95399	Te Karaka Recreation Ground	Skate ramp	Skate bowl/street skate	Edges broken chipped, coping to concrete come away - major drainage problem with flooding and silt throughout entry - under water.	3	Repair with epoxy or concrete as per concrete specialist's advice.	\$1,000.00
95398	Te Karaka Recreation Ground	Basketball half court	Half court and hoop	Hoop gone broken	1	Replace and repair hoop.	\$500.00
95432	Te Puia Hospital Community Playground	Module	Medium wooden	2 nails exposed on deck equipment dirty mossy	3	Remove exposed nails Water Blast and clean.	\$50.00
95433	Te Puia Hospital Community Playground	Safety surface	Surface for module	Depth 200mm compact weeds in it.	3	Aerate and weed surface	\$-
95626	Tokomaru Bay Foreshore Reserve	Swings	Swings 3 bay 2 senior 1 junior	Junior swing plate lifted, 1 senior swing seats plate lifted,	3	Replace junior and senior swing seat	\$245.00
95630	Tokomaru Bay Foreshore Reserve	Skate bowl	Street skate	Concrete undermined, chipped in one place, silt and dirt build up.	3	Fill in earth behind concrete, and epoxy chip.	\$20.00
	Tokomaru Bay Foreshore Reserve	Fitness	Jumps	Timbers splintered sharp, bolt protrusions.	3	Plane off broken splinters cap or remove protrusions.	\$-
	Tokomaru Bay Foreshore Reserve	Fitness	Jumps	Timbers splintered sharp, bolt protrusions.	3	Plane of broken splinters cap or remove protrusions.	\$-
	Tokomaru Bay Foreshore Reserve	Fitness	Side jumps	Timbers splintered sharp, bolt protrusions.	3	Plane of broken splinters cap or remove protrusions.	\$-
	Tokomaru Bay Foreshore Reserve	Fitness	Hurdles	Timbers splintered sharp, bolt protrusions.	3	Plane off broken splinters cap or remove protrusions.	\$-
95795	Tolaga Bay	Swings	1.5 bay swings	Top frame rusting	3	Monitor	\$-
95794	Tolaga Bay	Module	Module small	Wheel gone - sharp edge remains, graffiti, equipment dirty mossy.	3		\$50.00
95797	Tolaga Bay	Basketball half court	Hoop half court	Concrete cracks, backboard plate rusting at back, monitor base rusting.	3	Continue to monitor backboard rust, long term needs replacement.	-
95799	Tolaga Bay	Skate street skate	Street skate	Edges breaking away, sharp exposes, splits in concrete, x3 metal plates bolts removed and	3	Repair replace plates/bolts resecure, fill in undermined concrete.	\$500.00

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
				lifted, concrete undermined at end.			
97089	Waihirere Domain	Swings	1 bay	Frame rusted, dirty, unused, plate lifting on swing seat, bracing arms rusted badly.	1	Remove item	\$-
97129	Waihirere Domain	Safety surface	Surface for swing	Tile split and lifted	3	Remove item	\$-
97093	Waihirere Domain	Swings	3 swings	Frame rusted brackets rusted	2	Monitor until replacement.	
97129	Waihirere Domain	Safety surface	Safety surface for swings	Scuffed under swings	2	Cover footing	\$-
97094	Waihirere Domain		Swings	Frame rusted brackets rusted 1 bracket bent out of shape.	2		\$-
97129	Waihirere Domain	Safety surface	Safety surface for swings	Scuffed under swings	2	Reposition bark	\$-
97092	Waihirere Domain	Slide	Small embankment slide	Slide undermined eroded concrete exposed, big gap at entry dirty rusted base, very slippery dangerous entry.	1	Remove this item.	\$100.00
97091	Waihirere Domain	Slide	Long embankment slide	Rusting frame, dirty, sharp edges, footings undermined and exposed remove, rusting sliding section, entry stairs broken, mat at exit peg lifted, mat split.	2	Monitor repair sharp edges until replaced.	\$100.00
97090	Waihirere Domain	Seesaw	4 seater old style	Post in falling space, surface under water very muddy, frame rusting.	2	Remove post, monitor until replaced.	\$-
97129	Walhirere Domain	Safety surface	Mats under seesaw	Hard post in surface area, mats lifted hard peg exposed, under water.	2	Remove post, reposition peg so it is not exposed.	\$-
93198	Abbott Street Reserve	Swings	3 bay 2 senior 1 junior	Raise swing seat height for compliance.	3		\$-
93199	Abbott Street Reserve	Safety Surface	Surface for swings	Depth 300mm badly scuffed under swings.	2	Reposition bark and rake back under the swings. Programme this regularly.	\$-
93247	Adventure Playground	Swings	1 bay 2 serious high swings	Senior swing seat plate lifted sharp.	3	Replace senior swing seat.	\$75.00
93257	Adventure Playground	Safety Surface	Surface for mega swings	Scuffed under swings, depth 250mm.	3	Aerate and reposition bark.	\$-
93254	Adventure Playground	Safety Surface	Surface for new pgg module	Scuffed compact with ponding 250mm.	3	Aerate and reposition bark.	\$-

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
108605	Adventure Playground	Module large	Module large	Chain connection to chain bridge broken bolt out.	1	Repair	\$25.00
93248	Adventure Playground	Swings	Swings 3 bay 2 senior 1 junior by lake	Top bolts rusting, swing seat chipped	3	Monitor	\$-
93259	Adventure Playground	Safety Surface	Surface for swings and slide module	Scuffed under swings.	3	Aerate and reposition bark.	\$-
93239	Adventure Playground	Roctopus		Plates rusting.	3	Treat corrosion and monitor for advancement.	\$20.00
93246	Adventure Playground	Spinner	Seated spinner	Base starting to rust, ply top splintered.	3	Treat corrosion and monitor for advancement. Plane off ply top.	\$50.00
93249	Adventure Playground	Swings	6 way swings	Seats all bent, badly rusted frame throughout, rusted brackets.	3	Replace bent seats and treat rust, but replacement is recommended.	\$600.00
93244	Adventure Playground	Spinner	Small yellow spinner in other section.	Cap missing	3	Replace cap.	\$50.00
93255	Adventure Playground	Safety Surface	Surface for 6 way swings and Roktopus, spinner.	Depth 250mm but badly scuffed and compact.	3	Reposition bark where scuffed.	\$-
93237	Adventure Playground	Module large	Preschool module	Badly rusted rails x3, badly rusted support legs on slide x6, rusted bolts, rung on stairs rusted, clatter bridge D shackles badly rusted.	1	Replace all rusting hardware and support leg.	\$2,000.00
93256	Adventure Playground	Safety surface	Surface for preschool module	Compact and scuffed under slides 300mm.	3	Reposition bark where scuffed.	\$-
93238	Adventure Playground	Rope climber	Rope climber	Central frame badly rusted will affect structural integrity, rope connections move not secured.	2	Monitor rusting parts will need to replace these. Programme this part for replacement, see photos Re-secure rope connections.	\$500.00
93242	Adventure Playground	Spinner	Spica type	Cap missing	3	Replace cap.	\$50.00
na	Adventure Playground	Spinner	Spinner seated	Ply splintered on sides, base starting to rust.	3	Sand back splinters in ply.	\$-
93252	Adventure Playground	Safety Surface	Surface for spinner, seesaw swings.	Scuffed under swings very compact.	3	Remove weeds, aerate and reposition bark.	\$-
	Olympic pool	Module	Module large	Missing activity main frame rusted badly, missing bolt on track ride glide frame, decks splintered worn slides split but plastic welded so ok.	1	Replace missing item, if it is due to rusted frame remove frame. Replace missing bolt on track ride glide frame, plane off splintered decks.	\$500.00
	Olympic pool	Safety surface	Surface for module.	Uneven with gaps.	3	Fill gaps	\$1,000.00

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
	Olympic pool	Safety surface	Surface for wheelchair swing	Uneven undulating with large gaps	3	Fill gaps to avoid trip hazard.	\$1,000.00
	Olympic pool	Swings	Wheelchair swing	Dirty seat and bit of rust showing.	3	Clean seat.	\$-
93313	Alfred Cox Park	Skate street skate	Skate bowl	Ply lifted and split, ply box split and coming away, sharp metal edge lifted, nails on side rail coping coming away.	2	Repair ply, re-secure ply and re-secure sharp metal edge.	\$500.00
93313	Alfred Cox Park	Skate bowl	Skate bowl	Ponding concrete chipped at top entry.	3	Monitor for degradation.	\$-
93313	Alfred Cox Park	Skate bowl	Skate bowl	Drainage at base appears to be a problem lot of detritus in base.	3	Clean out drain.	\$100.00
93311	Alfred Cox Park	Skate ramp	Skate ramp ply high	Nails lifted on ladders lots, ply spit and lifting.	2	Re-secure nails, plane of splintered play and re-secure.	\$-
93312	Alfred Cox Park	Skate ramp	Skate ramp ply low	New skin rail on edge lifting, split in base.	3	Re-secure skin.	\$-
93359	Anzac Park Playground	Roctopus		Concrete footing exposed, main timber post split.	3	Cover footing monitor split.	\$-
93363	Anzac Park Playground	Safety Surface	Surface for Roktopus, module, slide and swings.	Bark depth 250mm scuffed under swings.	2	Reposition bark where scuffed.	\$-
93360	Anzac Park Playground	Seesaw	Seesaw 2 seater old style	Sideways movement.	3	Monitor for deviation of 140mm. Ensure there is no pinch (i.e closing of gap) in sideways movement at axle.	\$-
93386	Atkinson Street Reserve	Safety surface	Surface for swings	Depth 300 plus badly scuffed.	3	Rake back into place.	\$-
na	Atkinson Street Reserve	Safety surface	Surface for climber	Depth 250, 230mm, edge broken nail exposed`.	3	Repair edge, recess exposed nail.	\$100.00
93386	Atkinson Street Reserve	Safety surface	Surface for climber	Depth 250mm broken edge.	3	Aerate bark and repair edge.	\$-
93388	Atkinson Street Reserve	Basketball half court	Half court and hoop	Backboard rusting.	3	Monitor	\$-
93389	Atkinson Street Reserve	Skate street skate	Skate	Concrete chipped away by coping, coping rusting.	3	Treat corrosion, and epoxy chipped concrete to maintain a smooth surface.	\$250.00
93431	Ayton Park	Climber	Climbing rainbow ladder -arch climber.	Footing rusted.	3	Monitor programme replacement.	\$200.00
93432	Ayton Park	Climber	Climbing rainbow ladder -arch climber	Footing rusted.	3	Monitor programme replacement.	\$200.00

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
93437	Ayton Park	Safety Surface	Surface for seesaw, climber	Depth 250,220mm, compact-edges old worn nail exposed split.	3	Aerate bark	\$-
93436	Ayton Park	Safety Surface	Surface for swings climber	Depth 300, 300mm but badly scuffed under swings – compact.	3	Rake back scuff under swings and removed exposed root.	\$-
93460	Barry Park Reserve	Safety Surface	Surface for swings	Depth 250mm scuffed under swing.	3	Reposition bark under swings provide scuff mats.	\$500.00
96771	Blackpool Street Reserve	Swings	3 bay 2 senior 1 junior	Senior swing seat plate starting to lift.	3	Tamper down plate.	\$-
97116	Blackpool Street Reserve	Safety Surface	Surface for swings and Spica	Depth 300mm plus, scuffed under swings.	3	Reposition bark under swings.	\$-
	Blackpool Street Reserve	Fitness	Pullup	Seat spit	3	Repair seat.	\$200.00
	Blackpool Street Reserve	Fitness	Leg press	Seat split	3	Repair seat.	\$200.00
93553	Botanical Gardens	Spinner	Seated spinner	Ply splintered paint chipped	3	Sand back rough surface and paint.	\$-
93554	Botanical Gardens	Flying Fox	Double	1900 to cable.	2	Retention to ensure seat height is 400mm when loaded with 130kg.	\$-
93562	Botanical Gardens	Seesaw	Caterpillar seesaw	Handle ears missing timber split.	3	Fill holes to remove finger entrapments.	\$-
93557	Botanical Gardens	Xylophone	Music play	1 handle missing.	3	Replace handle.	\$-
93571	Botanical Gardens	Trampoline	On mound	Rubbish in base weeds in base.	2	Remove bouncing surface to remove rubbish.	\$-
93571	Botanical Gardens	trampoline	on mound	rubbish in base weeds in base	2	remove bouncing surface to remove rubbish	\$-
93575	Botanical Gardens	Safety Surface	Surface for slide and tramps	Split in places	3	Repair splits in surface, glue so they don't lift further.	\$100.00
na	Botanical Gardens	Safety Surface	Surface for junior area	depth 300mm scuffed in places	3	Rake to even depth of loosefill	\$-
93573	Botanical Gardens	Safety Surface	Surface for senior area	Depth 300mm scuffed in places, weedmat starting to lift, mat edges exposed so will form trip.	3	Aerate to remove scuff relocate for even surface, bury weed mat and mats.	\$-
93561	Botanical Gardens	Roctopus		Paint chipped	3	Programme repaint	\$-
93881	Centennial Reserve	Crescent Swings	Swing 3 bay 2 senior 1 junior	Frame rusting ok swing seats high at 800mm	3	Monitor rust, lower swing seat height to min of 400mm.	\$-
93882	Centennial Reserve	Crescent Safety Surface	Surface for swings	Depth 300, 350mm scuffed	3	Reposition bark under swings.	\$-

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
93946	Coldstream Road Reserve	Swings	Swings 3 bay 2 senior 1 junior	Graffiti	3	Remove graffiti	\$-
93947	Coldstream Road Reserve	Safety surface	Surface for swings	Depth 300mm scuffed under swings.	3	Reposition bark under swings.	\$-
93989	Emily Street Reserve	Swings	Swings 3 bay 2 senior 1 junior	Junior swing seat plates lifted and sharp.	3	Tamper down plate or replace seat.	\$150.00
93991	Emily Street Reserve	Safety surface	Surface for swings	Gaps in tile to timber edge	3	fill gaps	
93987	Emily Street Reserve	Climber	Monkey bars	Rusted at welds	3	Monitor rust, paint with corrosion treatment.	\$20.00
93988	Emily Street Reserve	Seesaw	Old style	Central fitting loose	3	Tighten fitting	\$-
93990	Emily Street Reserve	Safety surface	Surface for seesaw and climbers	Depth 250mm	3	Aerate bark regularly.	\$-
94369	Heath Johnston Park	Swings	Swings 3 bay 2 senior 1 junior	Senior swing seat lifted, seats too low badly scuffed- raise swing seat height to match surface height.	2	Tamp downseat plate. Re hang so seats are 500mm from ground. Rake bark back under swings.	\$-
94370	Heath Johnston Park	Safety surface	Surface for large module and swings	Depth 350mm badly scuffed under swings	3	Rake back scuff under swings	\$-
94433	Ida Road / Ralph Street Playground	Swings	Swings 3 bay 2 senior 1 junior	Plates starting to lift monitor	3	Tamp down plate	\$-
94434	Ida Road / Ralph Street Playground	Safety surface	Surface for swings	Scuffed under swings depth 250-300mm.	3	Rake back into place	\$-
94462	Kaiti Beach Swing Set	Swings	3 bay swings 3 senior	Main brackets all badly rusted to frame, raise swing seat height.	2	Replace brackets, consider replacement of swing frame, raise swing seat height.	\$650.00
94484	Kaiti memorial park	Basketball half court	Half court and hoop	Hoop rusting ok	3	Monitor	\$-
94552	London Street Reserve	spacenet		Retention	3	Re-tension rope	\$-
94551	London Street Reserve	Module medium	Module small	Graffiti	3	Remove graffiti	\$-
94554	London Street Reserve	Safety surface	Surface for all items	Water ponding			-
94566	Lytton West Rimu Grove	Safety surface	Surface for swings and module	Depth 250-300mm badly scuffed under swings.	3	Aerate reposition bark.	\$-
94564	Lytton West Rimu Grove	Module	Module small	Toggle gap filler come out replace it	3		\$-
94565	Lytton West Rimu Grove	Swings	Swings 2 bay 2 senior 1 junior	Frame rusting ok plate lifting.	3	Monitor	\$-
96156	Lysnar Domain	Module medium	Fort structure decks	Bolts rusted, timber split	3		\$150.00

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
96158	Lysnar Domain Wainui	Swings	Swings 3 bay 2 senior 1 junior	Swings seats too low at 300mm, frame rusting	3	Raise swing seat to 450mm minimum, monitor frame.	\$-
96161	Lysnar Domain	Safety surface	Surface for swings				
96159	Lysnar Domain	Swings	Swings 3 bay 2 senior 1 junior	Junior swing seat plate lifted, frame rusting	3	Replace junior swing seat, rust treat frame to extend life.	\$170.00
94672	Makarori Playground	Seesaw	2 seater old style		3	Tighten central bolts.	\$-
94673	Makarori Playground	Swings	Swings 3 bay 2 senior 1 junior	Swing seat plates rusting still ok monitor - frame rusting.	3	Monitor tamper down plates, treat rust to extend life span.	\$-
94694	Mangapapa Reserve	Safety Surface	Surface for slide, climber	Depth 300mm, edge broken one place.	3	Repair timber edge.	\$25.00
94693	Mangapapa Reserve	Safety Surface	Surface for swings	Depth 300mm, scuffed under swings edge broken one place.	3	Reposition bark under swings.	\$-
94776	Mary Street Reserve	Swings	Swings 3 bay 2 senior 1 junior	Seats too low	3	Raise swing seats	\$-
94777	Mary Street Reserve	Safety surface	Surface for swings	Depth 300, 250mm badly scuffed.	3	Aerate reposition bark.	\$-
94863	Nelson Road Playground	Module/Fort		Rusted bolts on underside, rotten timbers slide split at centre, hard edge at base of slide sides rusting, decks splintered - slide lifted in two places, face downwards but can lift.	2	Replace rotten timber repair slide- repair until replaced.	\$400.00
94865	Nelson Road Playground	Safety surface	Bark surface for swings and module	Depth 250mm scuffed under swings.	2	Aerate and redistribute so even. Re-secure mat.	\$-
95535	Titirangi Playground	Module large		Splintered split timbers, broken timbers, rusting brackets, slide split at top, main deck bent, toggle.	1		\$400.00
95762	Tyndall Road Reserve	Slide mound	2 slides on mound	Toggle entrapment at top of stainless slide, mat at bottom of slide lifted, sharp plate on side of slide at ground level, timber split on deck.	1	Cover entrapment (i.e. close up gap). Remove sharp peg and Re-secure mats, repair timber split.	\$50.00
95760	Tyndall Road Reserve	Flying fox	Flying fox	Seat too low retention cable to ensure height.	2	Replace chain cover, and seat. Install seat at 450mm ground clearance.	\$150.00
95764	Tyndall Road Reserve	Safety surface	Surface for flying fox	Depth 200mm scuffed hole in bark.	3	Rake back into place regularly.	\$-
94176	Waikanae Beach Reserve	Rope climber		Main connection ring rusting, worn shackles	3		\$-

Compkey	Address	Asset Description	Asset Details	Maintenance Issue	Priority	Maintenance recommendation	Repair Value
94184	Waikanae Beach Reserve	Safety Surface	Surface for rope climber	Split in two places, lifted further needs repair.	2	Repair splits before they can be vandalised.	\$100.00
94182	Waikanae Beach Reserve	Swings	3 bay 2 senior 1 junior closest to surf club	Frame rusting bracket at elbow and plate rusting.	3	Treat corrosion and monitor for structural stability, replace swing seat.	\$250.00
94182	Waikanae Beach Reserve	Swings	3 bay 2 senior 1 junior	Frame rusting at elbow, rusting at footing.	3	Treat corrosion and monitor for structural stability.	\$150.00
94179	Waikanae Beach Reserve	Spinner	Dippy disc? Large spinner	Rusting at base underside plate and footing rusting, ply splintered.	3	Follow up warranty.	\$-
94180	Waikanae Beach Reserve	Spinner	Small seated spinner	Rusting at base ply splintered.	3	Follow up warranty	\$-
94185	Waikanae Beach Reserve	Safety Surface	Surface for swings, spinners, seesaws	Bark depth 250-200mm scuffed under all items.	3	Aerate and rake.	\$-
96000	Waikiriri Reserve Dalton Street Playground	Climber		Graffiti, surface nil at base, timber footings on wall climber rotting.	3		
95924	Wainui Beach	swings		junior swing seat plate lifted	3	replace seat	\$175.00
95923	Wainui Beach	Seesaw		Sideways movement.	3	Reduce sideways movement.	\$-
95925	Wainui Beach	Safety surface		Depth 200mm very compact scuffed and worn, weeds throughout.	3	Reposition bark where scuffed.	\$-
96041	Waiteata Park Playground	Roctopus		Footing exposed.	1	Cover exposed footing in 400mm loosefill.	\$500.00
96043	Waiteata Park Playground	Safety surface	Surface for Roktopus and climber.	Depth 250, 320,300mm- scuffed out under Roktopus.	3	Rake bark back into place regularly.	
96042	Waiteata Park Playground	Swings	Swings 3 bay 2 senior 1 junior	Swings too low, seat chipped.	3	Replace 1 senior swing seat, raise seat height.	\$75.00
96044	Waiteata Park Playground	Safety surface	Surface for swings	Depth 300mm, scuffed	3	Reposition bark under swings.	\$-
96039	Waiteata Park Playground	Module	Module with slide	Deck split at stair entry	1	Repair splinter	